


Grundboringer i

Nr. 36 Dronningensgate og Nr. 29 Skippergaten.

M. 1:250

DRONNINGENS GATE

SKIPPERGATEN

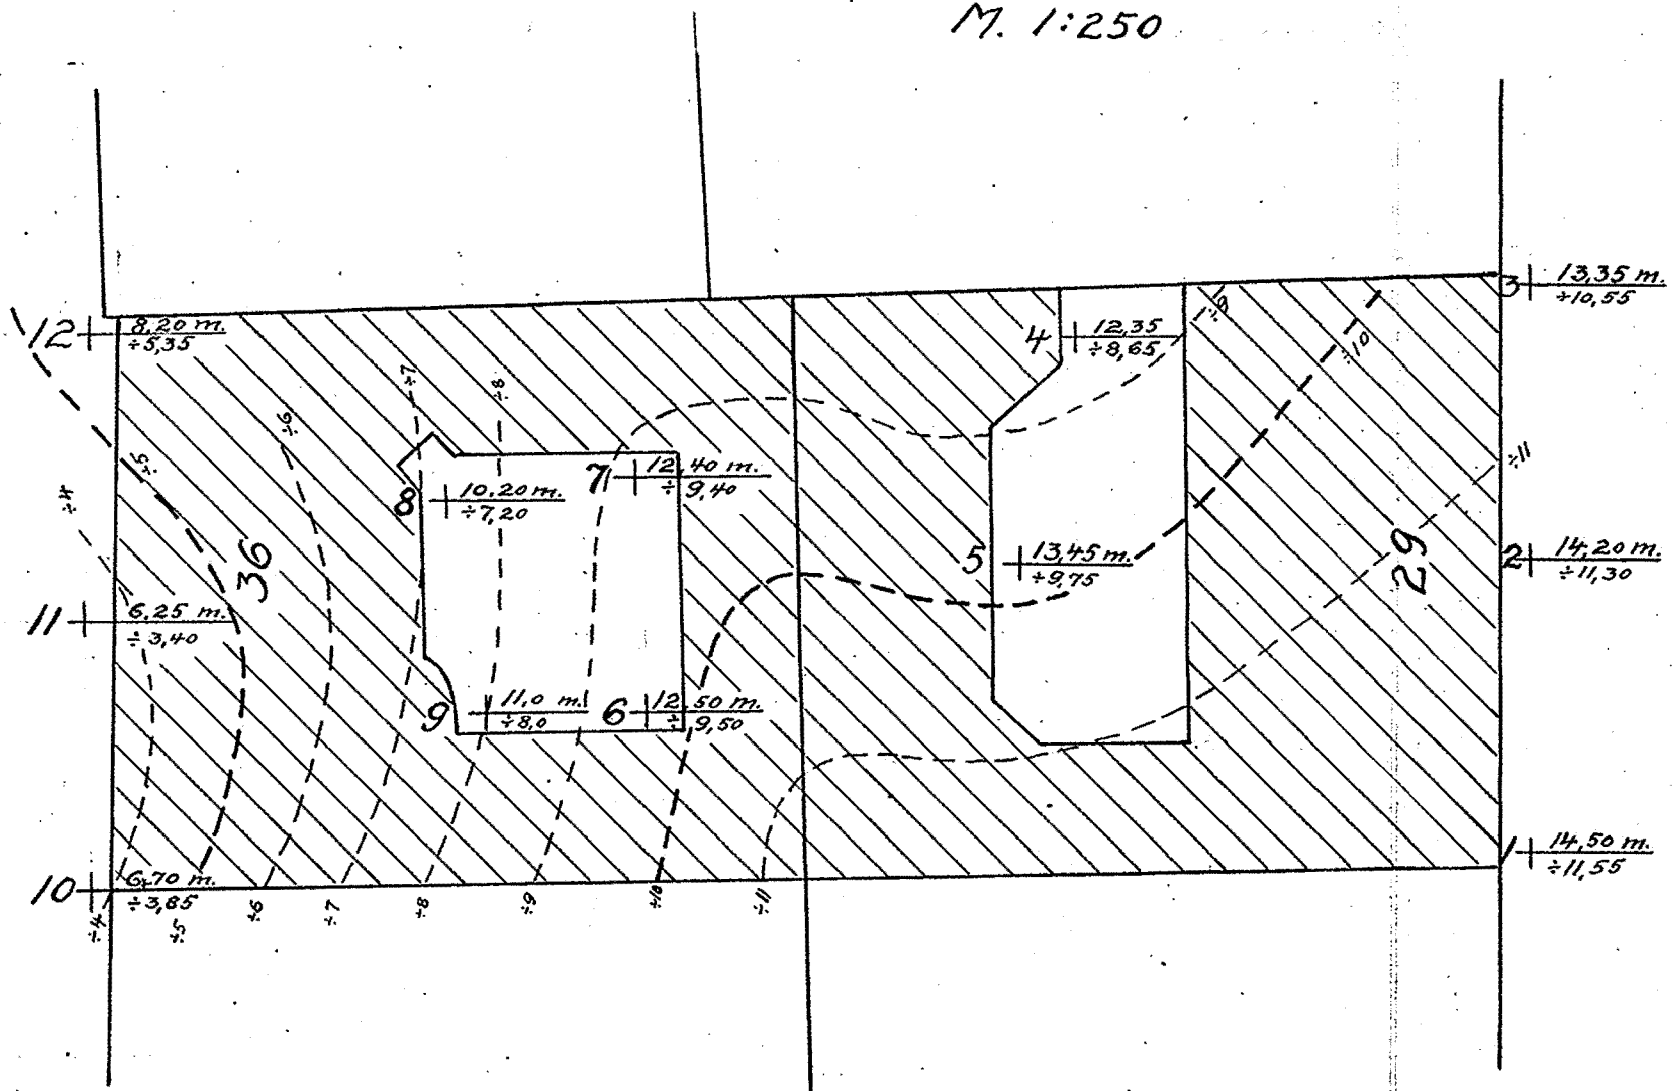

Jordlagenes beskaffenhed:	Borhul nr.											
	1	2	3	4	5	6	7	8	9	10	11	12
Fyld i meter	2,0	2,0	2,0	2,25	2,25	2,0	2,0	2,0	2,0	2,0	2,0	2,0
Fast lere	-	-	-	-	-	1,0	1,0	1,0	1,0	1,0	1,0	1,0
Bløt lere	-	-	11,35	10,10	11,20	9,50	9,40	7,20	8,0	3,50	3,25	5,0
Sandbl. bløt lere	12,50	12,0	-	-	-	-	-	-	-	-	-	-
Grus	-	0,20	-	-	-	-	-	-	-	0,20	-	0,20
Dybde tils.	14,50	14,20	13,35	12,35	13,45	12,50	12,40	10,20	11,0	6,70	6,25	8,20

Tal og streken angir dybde fra terræng til fjeld.

" u. --- " fjeldhøide i forh. til ±0

Stregede kurver " --- " " " " ±0

Kristiania, mai 1918.  
Oscarhøye.