


\*SO: B1 IV

79

Akersgt. 11

## GRUNDBORINGER I NR. 11 AKERSGATEN.

M. 1:250.

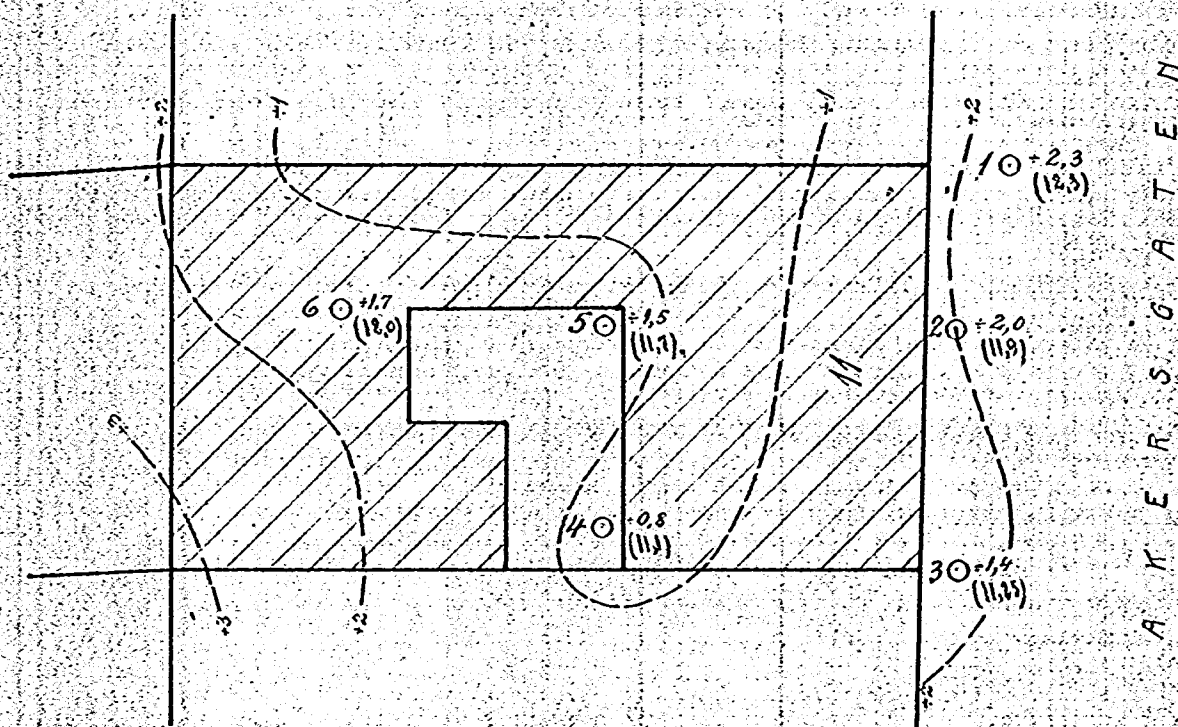

Jordlagenes beskaffenhed:	Borhul nr.					
	1	2	3	4	5	6
Fyld i meter	2,0	2,0	2,0	-	-	-
Fast lere "	3,0	3,0	3,0	3,0	3,0	3,0
Midlere bløt lere "	4,9	5,65	5,25	7,1	7,45	7,5
Grus "	-	-	-	-	-	0,5
Bløt lere "	-	-	-	-	-	1,0
Gruslag paa fjeld "	2,4	1,25	1,0	1,0	1,25	-
Dybde-fils.	12,3	11,9	11,25	11,1	11,7	12,0

Rette tal angir fjeldets cotehøide

Skraa tal (1,6) angir dybde fra terreng til fjeld.

Kristiania, november 1919.  
Oscar Karg.