

OSLO KOMMUNE. GEOTEKNISK KONSULENT


BORPROFIL

Hull 9
Nivå 15,6
Prøg

Aksialdetorsjon %

Bilag 7
Oppdrag R-542
Dato juni-53

Sted: KOMMUNEKJØRKEN

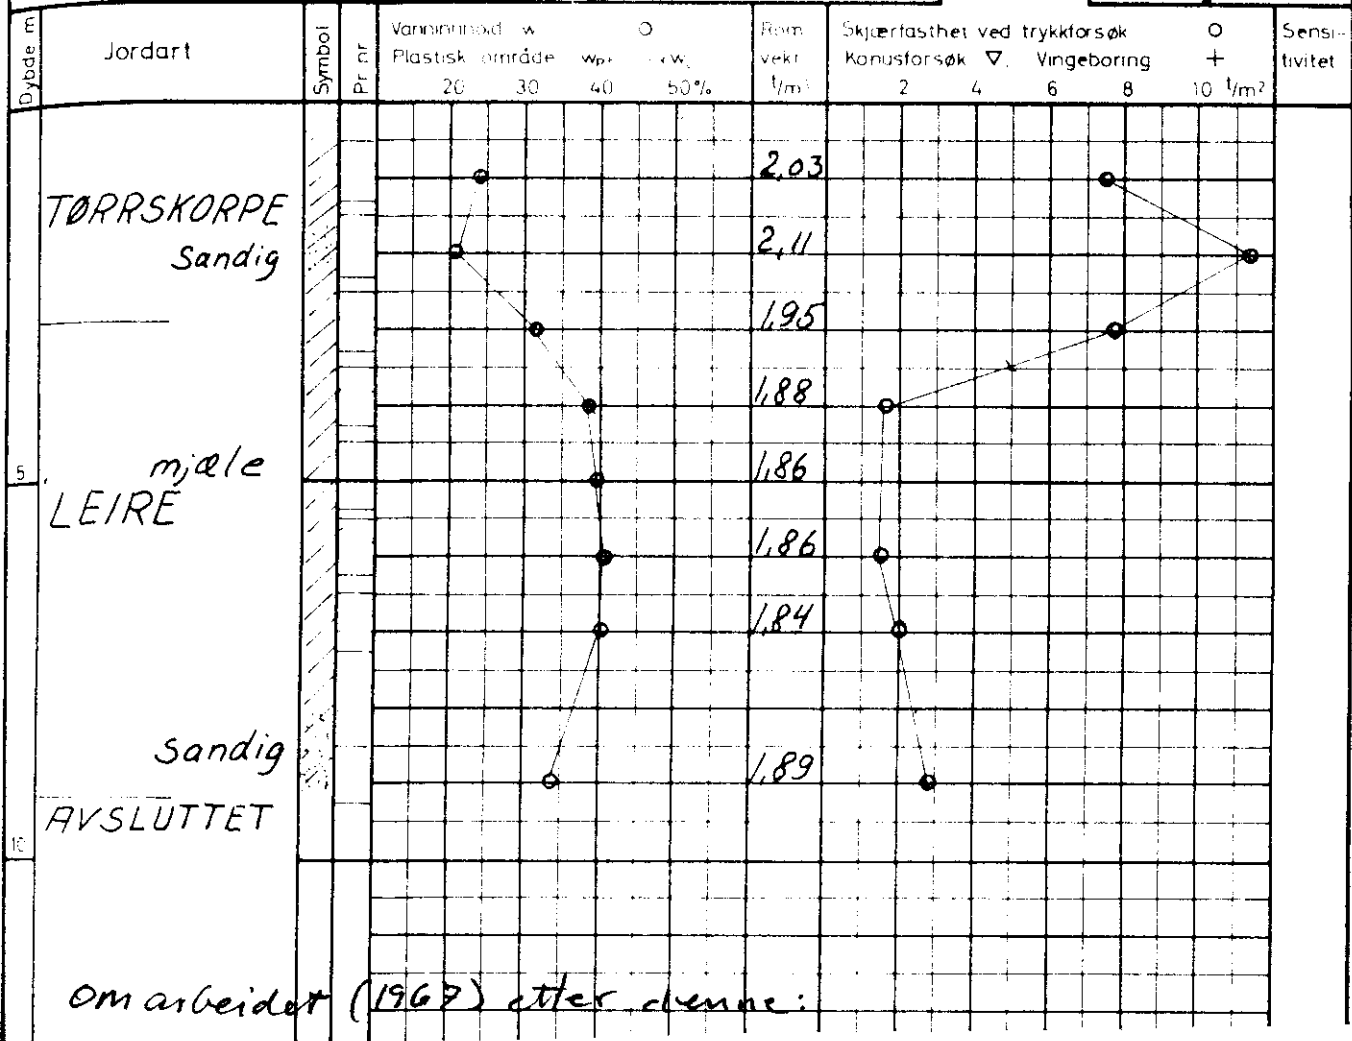

Terre: PRØVER:

H	V	F	IL	IS	IS	IS	IS	IS	IS	IS	IS	IS	IS	IS	IS	IS	IS	IS
294	396	42	179	563	76	203	1,8											Tørrskorpelære
206	361	41	435	140	107	211	1,5											" " " " sandig
517	471	51	132	605	79	196	1,1											" " " "
384	522	44	19	72	18	188	0,9											leire
323	529	42	14	-	-	186	0,9											Aljaleire (Omrørt)
410	458	44	13	63	16	186	0,9											" " " "
406	532	42	12	78	20	184	0,9											leire
576	485	41	25	117	29	184	0,9											leire, sandig

A. Knoph (Geoteam) tgn. G 156 (1953)