


Horis 100m

Hull 115


K94.0

1075

WL	WP	W	P	F	H ₁	H ₃	S _v	γ	0
35	17	282	444	49	189	296	5.5	2.01	0.9
38	19	310	462	36	31	267	5.2	1.95	
37	21	326	476	45	53	153	3.6	1.93	0.9
38	22	314	466	44	61	389	6.3	1.95	0.9
36	21	314	470	44	58	281	5.4	1.96	0.9
32	18	380	437	50	40	179	4.1	2.0	0.9
33	18	30.1	458	37	48	132	3.2	1.97	0.8
35	18	317	471			136	3.3	1.96	0.8
34	20	30.4	46.0	40	40	168	3.9	1.98	0



Leire
" "
" "
" / tørrskorpeflekker
" "
" / skjellrester
" / sprøtte sandkorn



Vingeboring og prøvetaking nedflyttet


1085

K90

K9

K80

K80

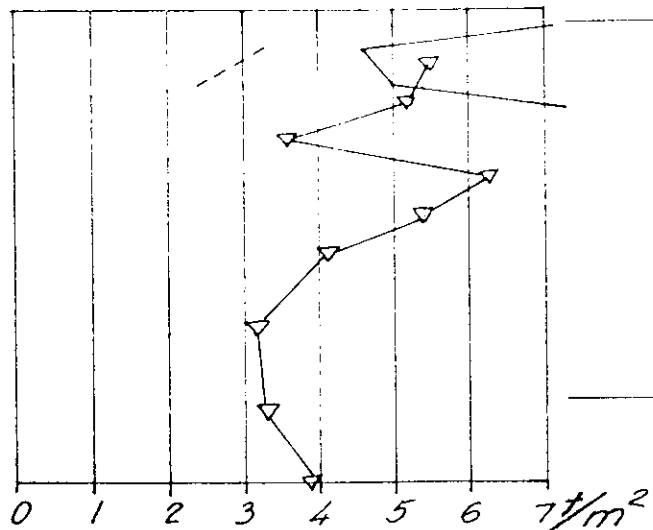

107S NOI3
NSB GK 2788-26
1961