

N O T E B Y

827

~~MØLLERVEIEN~~

Møllerveien 2

NO: C2 IV


28


827

VULKAN 1/5
 Grunnundersøkelser
 M = 1:500

Vulkan

N O

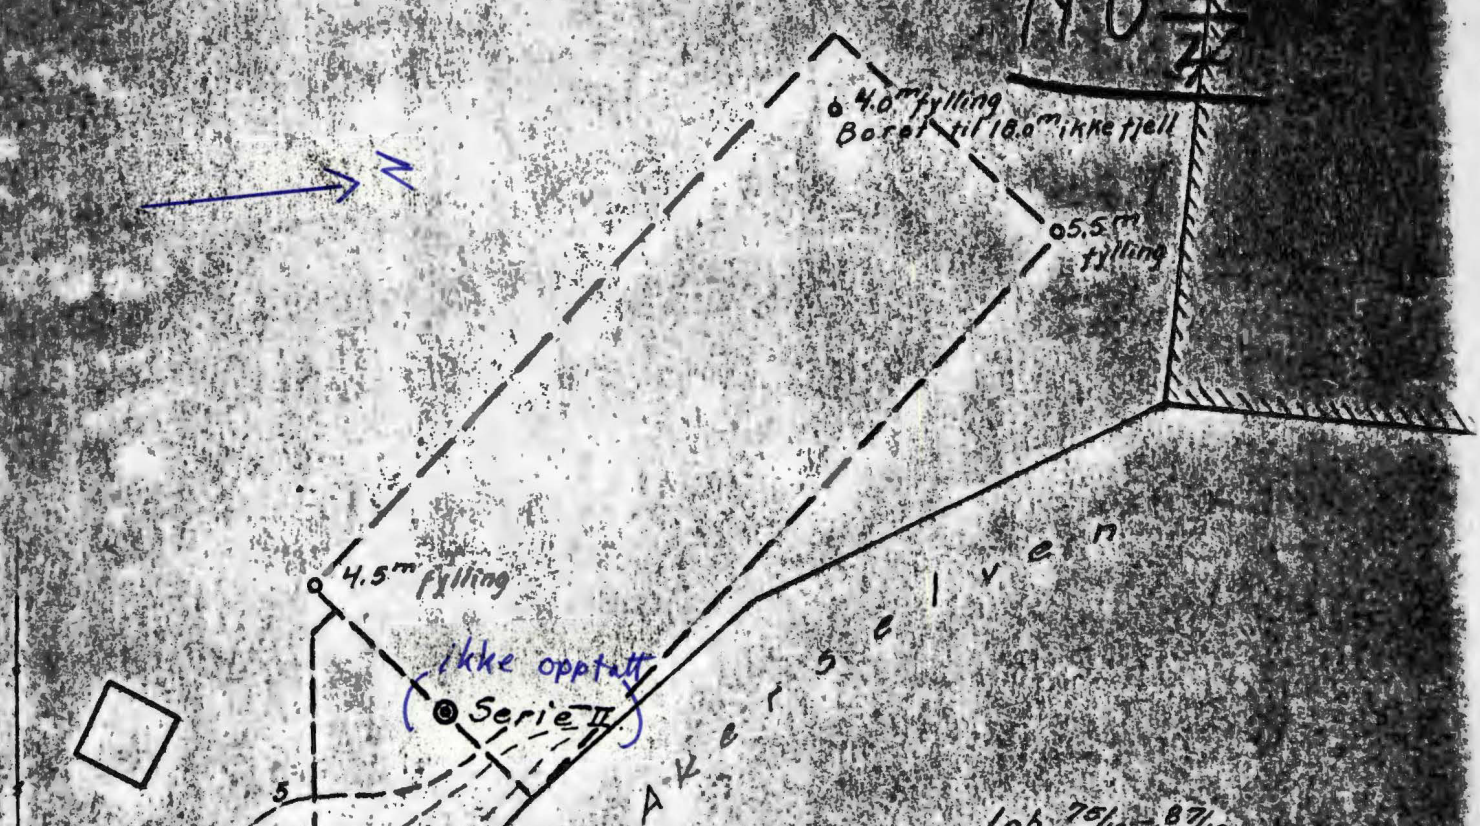

Lab 75/10 - 87/10

Dyp m.	V	F	H ₁	H ₂	K	Q	pH	Anm.
0.5								Koksslag
1.0								
1.5								Finmosand, leir
2.0								Røttent org. stoff
3.0								Elveslam og fyllmasse
4.0	46.3	39	37	158	3.7		7.5	Leire
5.0	53.5	51	32	163	3.8		7.5	Leire
6.0	53.8	58	21	184	4.2		7.5	Leire
7.0	48.9	43	28	132	3.2			Leire
8.0	46.6	37	26	140	3.4			Leire
9.0	49.8	42	24	117	2.9			Leire
10.0	46.8	37	28	132	3.2			Leire

... i vannprosent i
 ... i finhet
 ... omrørt prøve.

Oslø 24/11 - 1941

Bj. Røysdal

Tegning nr. 827