

NYD2

1015

1025


1035

1045

Pröver, utflyttat.

6.

10

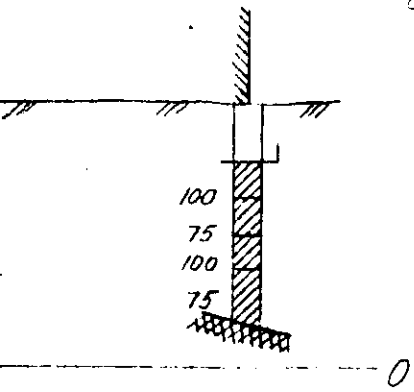


1015 Pröver. I

V.	F.	H ₁	H ₃	K.	
46.1	38	47	184	4.2	Leire.
47.2	36	20	179	4.1	—
50.0	30	3	110	2.8	—
50.8	30	0.8	81	2.1	Kvikkleire.
51.1	31	1.0	83	2.1	—
49.1	27	0.4	24		—, deformert.

1025 Pröver. II

V.	F.	H ₁	H ₃	K.	
47.0	40	34	168	3.9	Leire.
47.9	28	4	140	3.4	—
49.2	29	1.5	37	1.0	—, slapp.

10.

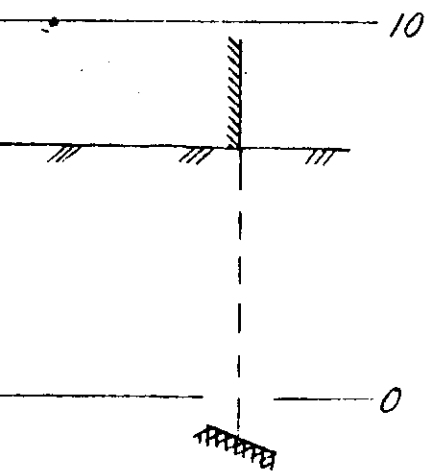

Pröver. III

1035

V.	F.	H ₁	H ₃	K.	
47.6	42	37	411	6.5	Törrskorpelire.
48.3	34	10	136	3.3	Leire.
49.6	30	2	127	3.1	—
51.8	30	1.0	61	1.6	Kvikkleire, slapp.

Pröver. IV


1045

V.	F.	H ₁	H ₃	K.	O.	Ph.	
49.3	46	37	526	7.4	1.5	5.4	Törrskorpelire.
49.0	35	10	104	2.6	1.2	7.0	Leire.
49.9	33	6	104	2.6	1.2	8.0	—
52.5	36	4	56	1.4	1.1	>8.0	—
52.5	36	5	59	1.5	1.0	>8.0	—
52.0	37	7	104	2.6	1.0		—
50.1	33	5	17				—, deformert.
47.9	31	6	23				Leire med sandkorn, deformert

16.

Pröver. IV

10

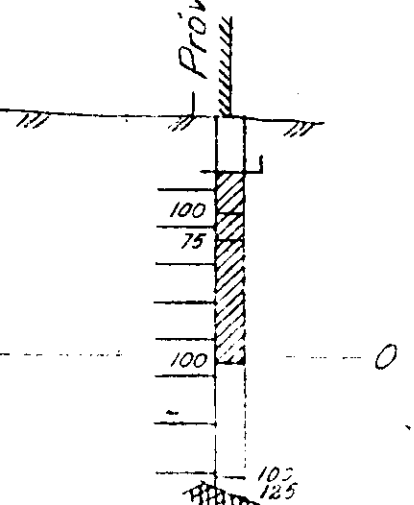

NSB GK-624
1946