


*SO: B1 II

66

Dronningensgt. 11

Grundboringer i nr. 11 Pronningensgate

M. 1:250

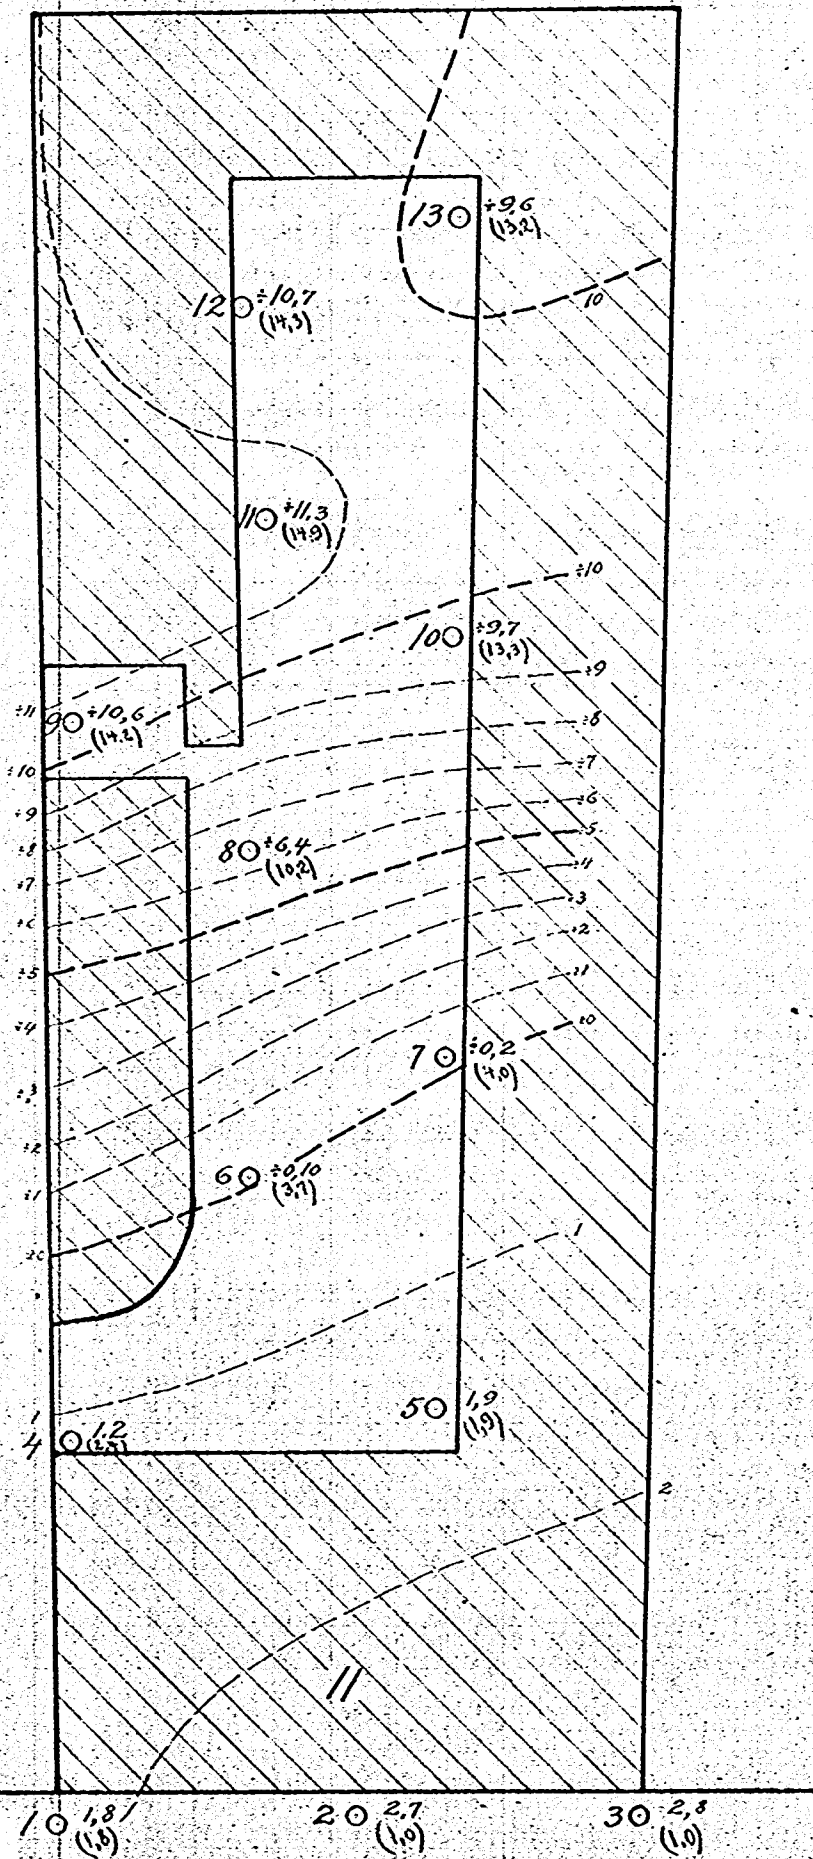

Jordlagenes beskaffenhet:	Borhul. nr.												
	1	2	3	4	5	6	7	8	9	10	11	12	13
Fyld	1,50	1,0	1,0	2,4	1,9	3,7	1,5	1,0	1,0	1,5	2,0	2,0	2,0
Mellere bløt lere "	-	-	-	-	-	-	2,5	2,2	10,6	10,8	-	-	-
Bløt lere "	-	-	-	-	-	-	-	-	-	-	9,9	9,3	10,2
Grov grus "	-	-	-	-	-	-	-	-	2,6	1,0	3,0	3,0	1,0
Pybde. tils. "	1,80	1,0	1,0	2,4	1,9	3,7	1,0	10,2	11,2	13,5	14,9	14,3	13,2

PRONNINGENS GATE

Rette tal angir fjeldets cotehøide.
 Skraa "(5)" angir dybde fra terrang til fjeld.

Kristiania, august 1919.
 Oscar Larsen