

NO14

1105


90

+

Hull 123

1105

⊙1025

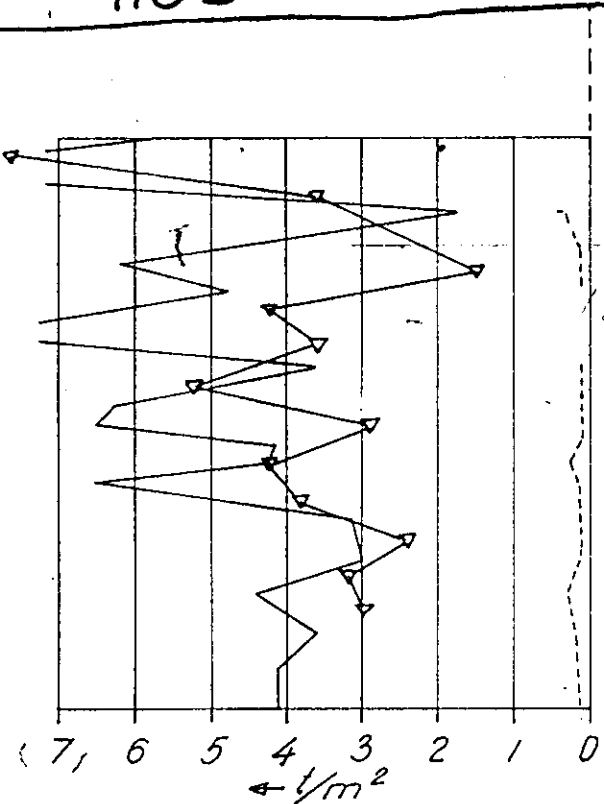

Depth (cm)	w	I _p	F	H _l	H _s	S _u	γ'	σ
400	23.5	39.6	36	267	895	9.5	2.08	0
600	28.2	44.0	53	296	563	7.8	2.0	0
800	36.4	48.7	43	24	153	3.6	1.83	1.8
1000	35.1	47.1					1.82	
1200	18.5	93.1	15	1.0	60	1.5	2.04	0
1400	28.2	43.4	23	1.0	184	4.2	1.97	0
1600	27.2	43.1	23	1.1	153	3.6	2.03	0
1750	11.2	23.2		3	267	5.2	2.31	0
	25.7	41.1			117	2.9	2.01	0
	35.4	49.1	33	6	184	4.2	1.88	0
	35.4	49.1			163	3.8	1.88	0.8
	36.0	49.8	30	13	95	2.4	1.88	0.8
	29.7	44.9			132	3.2	1.96	1.0
	17.6	32.2		8	120	3.0	2.15	0.9

Leire, mjelig

Finmo, sterkt forurenset

Fin sand og grovmo m/mye råtne planterester

Kvikkleire, sandig m/gruskorn

" mjelig m/partier av mosand

" "

Leire, sterkt sandig m/gruskorn

Kvikkleire, sandig

Leire, mjelig

Kvikkleire, mjelig

"

"

Leire, sandig m/tynne hor. lag av mosand

Alnabru godssta
Pel 100

Norges Statsbaner - Banedj
Geoteknisk kontor
Oslo 30/10 - 1962

NSB Gk 2788,31

D. Kvan